

## Test Report

Number: SZHH01064943

Applicant: FORINCORP INTERNATIONAL LIMITED  
香港新界葵涌打砖坪街 63-75 号  
冠和工业大厦 13 字楼 F 室

Date: Jun 13, 2016

Attn: Derrick Chan

### Sample Description:

Four (4) pieces of submitted sample said to be:

Item Code	Ean Code	Style No.	Item Description
153030263.	Not Provided.	02B2G001350.	Banquet Degustation S/6 Crystal Gls-Hiball-350ml.

Barcode No. : Not Provided.  
Vendor Stock No. : Not Provided.  
P.O. No. : Not Provided.  
Concept Name : Homecentre  
Vendor Name : Forincorp International Limited.  
Manufacturer Name : Not Provided.  
Importer's Name : Not Provided.  
Country of Destination : UAE.  
Country of Origin : Czech Republic.  
Date Sample Received : Jun 06, 2016



### Tests conducted:

As requested by the applicant, refer to attached page(s) for details.

To be continued

Authorized by:  
For Intertek Testing Services  
Shenzhen Ltd.

Ben N.L. Lin  
General Manager



Page 1 of 3

### Intertek Testing Services Shenzhen Ltd.- Hardlines

深圳天祥质量技术服务有限公司-轻工产品事业部

301A, 302B, 6/F. 7/F Shekou Technology Main Bldg. and Room 1E of Nanshan Building,

Nanhai Ave., Nanshan District, Shenzhen, China

深圳市南山区南海大道科技大厦 301A、302B、六层、七层、南山大厦 1 楼 1E 房

Tel: (86-755) 2602 0111 Fax: (86-755) 2683 7118/9 Postcode: 518067

www.intertek.com www.intertek.com.cn China Toll-Free: 400 886 9926

Attention is drawn to the terms and conditions printed overleaf.



**Test Report**

Number: SZHH01064943

**Conclusion:**

<u>Tested Article</u>	<u>Standard</u>	<u>Result</u>
Tested component of Submitted samples	European Council Directive 84/500/EEC Article 2 and Commission Directive 2005/31/EC on leachable Lead and Cadmium released from ceramic article intended to come into contact with foodstuff	See comment


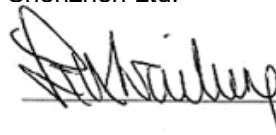
\*\*\*\*\*

**Comment:**

The scope of the standard was not applicable to the submitted samples. Testing was conducted with reference to the test method and requirements as stated.

\*\*\*\*\*

Authorized by:  
For Intertek Testing Services  
Shenzhen Ltd.



Ben N.L. Lin  
General Manager



Page 2 of 3

**Intertek Testing Services Shenzhen Ltd.- Hardlines**

深圳天祥质量技术服务有限公司-轻工产品事业部

301A, 302B, 6/F. 7/F Shekou Technology Main Bldg. and Room 1E of Nanshan Building,

Nanhai Ave., Nanshan District, Shenzhen, China

深圳市南山区南海大道科技大厦 301A、302B、六层、七层、南山大厦 1 楼 1E 房

Tel: (86-755) 2602 0111 Fax: (86-755) 2683 7118/9 Postcode: 518067

www.intertek.com www.intertek.com.cn China Toll-Free: 400 886 9926

Attention is drawn to the terms and conditions printed overleaf.

## Test Report

Number: SZHH01064943

### Tests Conducted

#### 1 Leachable Lead and Cadmium Content - Internal Surface

With reference to European Council Directive 84/500/EEC and Commission Directive 2005/31/EC by Atomic Absorption Spectrophotometric (AAS) analysis.

Tested Sample:

Tested Specimen	Leaching Volume (ml)	Result	
		Lead	Cadmium
		mg/l	mg/l
(1)	380	ND(<0.05)	ND(<0.03)
(2)	380	ND(<0.05)	ND(<0.03)
(3)	380	ND(<0.05)	ND(<0.03)
(4)	380	ND(<0.05)	ND(<0.03)
Limit (category 2) :		4	0.3

ND = Not detected

\*\*\*\*\*

End of report

*This report is made solely on the basis of your instructions and/or information and materials supplied by you. It is not intended to be a recommendation for any particular course of action. Intertek does not accept a duty of care or any other responsibility to any person other than the Client in respect of this report and only accepts liability to the Client insofar as is expressly contained in the terms and conditions governing Intertek's provision of services to you. Intertek makes no warranties or representations either express or implied with respect to this report save as provided for in those terms and conditions. We have aimed to conduct the review on a diligent and careful basis and we do not accept any liability to you for any loss arising out of or in connection with this report, in contract, tort, by statute or otherwise, except in the event of our gross negligence or wilful misconduct.*

